

17String cable shorting method

- 1.Preparation. The cable must be soldered to the battery pack first, and then plugged into the protection board after checking it correctly. Do not plug the cables into the protection board and then solder them to the battery pack one by one
- 2.When wiring, connect B negative first, then connect the cable, and finally connect C negative to the negative pole of the charger and the load. The battery is always connected to the charger and battery
- 3.Starting from the 15th series of cables on the board, connect the 15th to 19th series to the positive pole of the 15th series of batteries in the battery pack, the 20th series of cables to the positive pole of the 16th series of batteries, and the 21st series of cables to the total positive pole of the battery (That is, the 17th battery positive pole)

C negative to charge and discharge negative

