


## 8String cable shorting method

1. Preparation. The cable must be soldered to the battery pack first, and then plugged into the protection board after checking it correctly. Do not plug the cables into the protection board and then solder them to the battery pack one by one
2. When wiring, connect B negative first, then connect the cable, and finally connect C negative to the negative pole of the charger and the load. The battery is always connected to the charger and battery
3. Starting from the 6th series of cables on the board, connect the 6th to 19th series to the positive pole of the 6th series of batteries in the battery pack, the 20th series of cables to the positive pole of the 7th series of batteries, and the 21st series of cables to the battery Positive pole (that is, the positive pole of the 8th string of batteries)

## C negative to charge and discharge negative

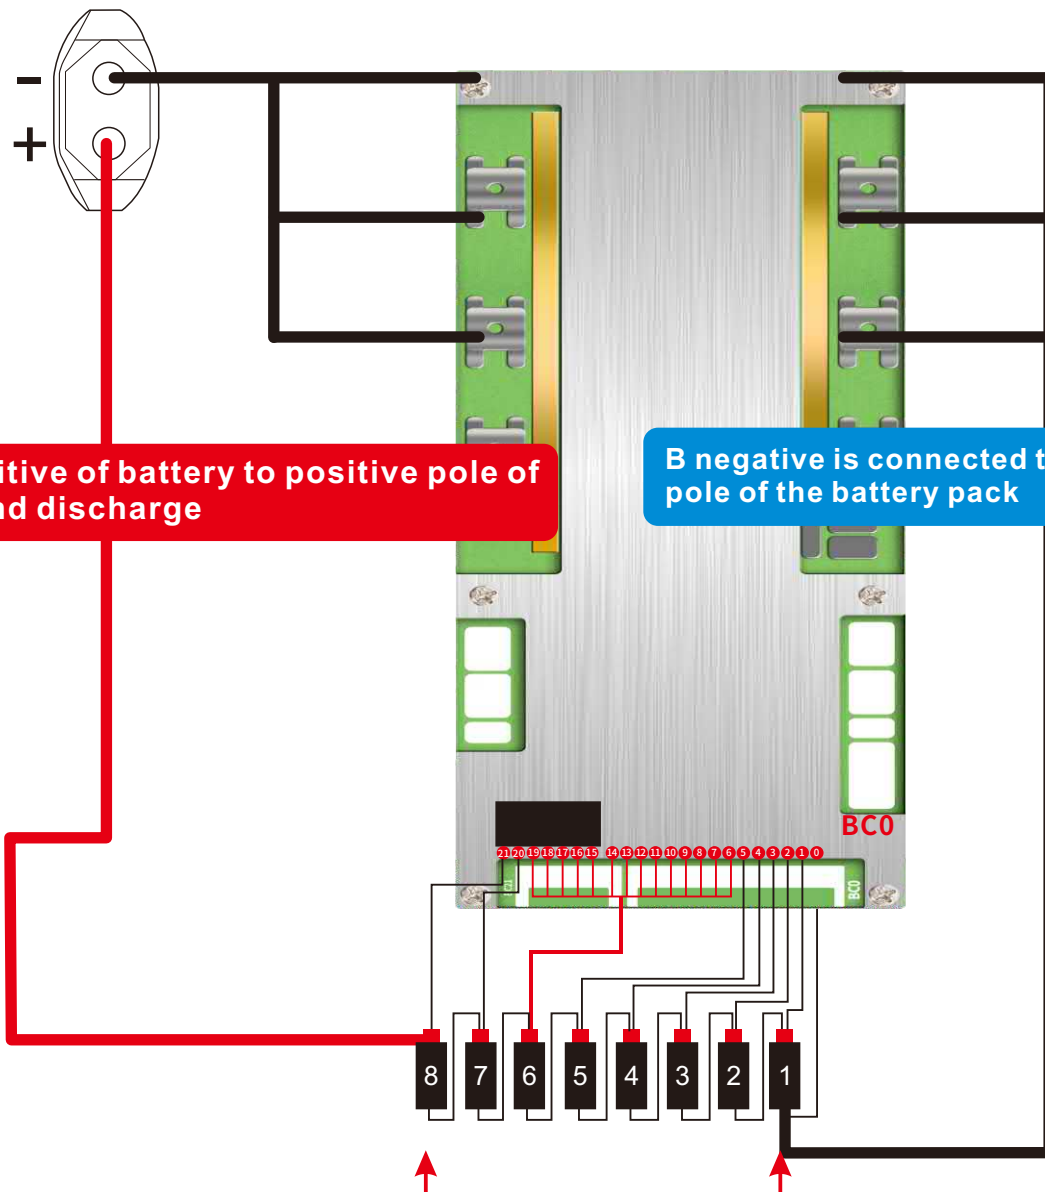

Total positive of battery to positive pole of charge and discharge

B negative is connected to the total negative pole of the battery pack

Total positive electrode of battery

Total negative electrode of battery